


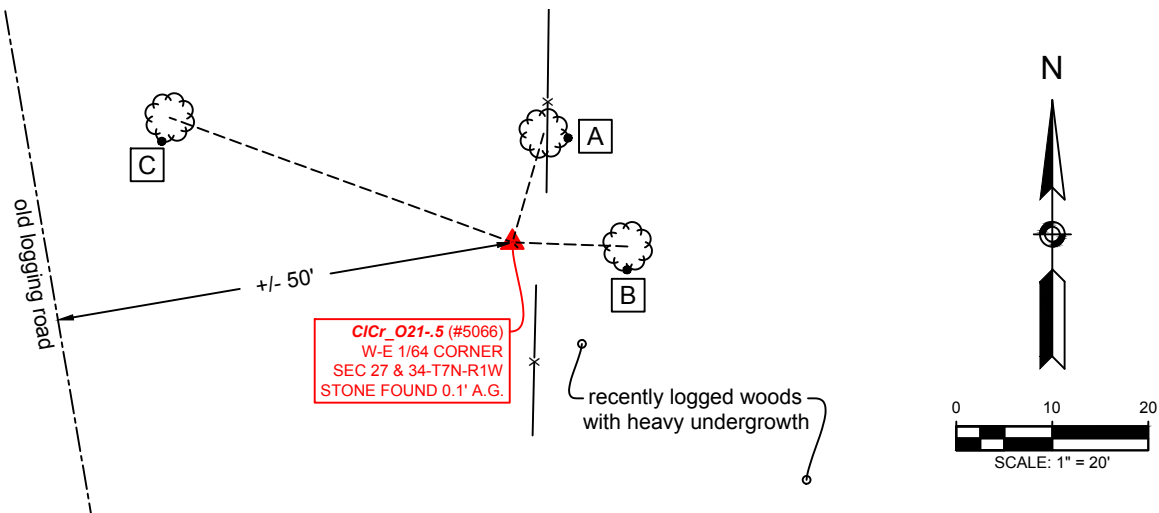

WITNESS MONUMENT TIES:


- MAG nail and shiner set in hack 0.9' above grade in the east side of a 13" ash with fence remains to the north and south; N16°E 11.8'
- MAG nail and shiner set in hack 0.9' above grade in the south side of a 13" hickory; S88°E 12.0'
- MAG nail and shiner set in hack 1.3' above grade in the south side of a 14.5" sycamore; N70°W 38.0'

OTHER ACCESSORIES:

A 5' steel t-post was set 3.7' above grade 0.75' southeast of the stone, with a Monroe County Survey Marker sign 3.0' above grade on the northwest side, facing the stone. A small cairn of rocks was piled around the stone.

OTHER OBSERVATIONS:

The stone is in line with fence remains to the north and south. It is located approximately 50' east of a north/south logging road in a heavily overgrown woods that appears to have been logged fairly recently. To reach the stone, park at the gravel lot just off Valley Mission Road on the south side of the drive to the Monroe Dam parking lot. Follow the mowed logging road until it turns off to the south just before a big gravel pile. Continue following the old logging road south for approximately 380 feet.

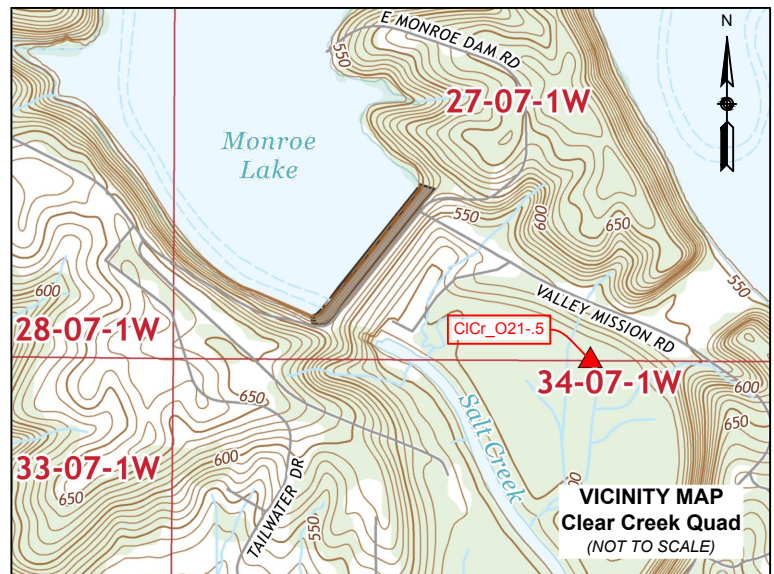

NOTES:

- Field work was performed on February 27 and September 21, 2017.
- Monroe County Surveyor's Field Book 48, page 65 and Field Book 50, page 75.
- Project Name: 34-T7N-R1W, Field work by: RSO & MCB, Drawn by: RSO, Reviewed by: RSO & TER.
- This document is not complete without the associated plat and report of survey for Section 34-T07N-R01W by Rachel Oser, of the Monroe County Surveyor's Office, dated May 29, 2018 and recorded as Instrument Number 2018006787 in the Monroe County Recorder's Office.
- Coordinates shown hereon were obtained from GPS observations utilizing the Indiana Real-Time Network (INCORS). Indiana West Zone, NAD83(2011) Epoch 2010.0000, State Plane Grid Coordinates, US Survey Feet. Geoid model G2012BU7. Datum NAD83_NO_TRANS.
- Coordinate data was collected using a Topcon PG-A1 antenna and a Topcon GRS-1 data collector.
- Witness ties were measured with a 2° compass adjusted for magnetic declination and a 100' cloth tape. Distances to bearing trees were measured from the monument to the MAG nail and bearings were measured from the monument to the center of the tree.
- Photos were taken with an iPhone 6s on 2/27/2017 and 9/21/2017.

▲ **Monument Description:** A 1.0' x 0.35' stone with 2"x2" cut "+" was found 0.1' above grade
State Plane Grid Coordinates: Northing: 1369212.5', Easting: 3116972.8'



SHEET
1
OF
2

MONUMENT RECORD
CORNER ID:
CICr_021-.5

West-East 1/64 Corner
Sections 27 & 34 - T07N-R01W
Clear Creek Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

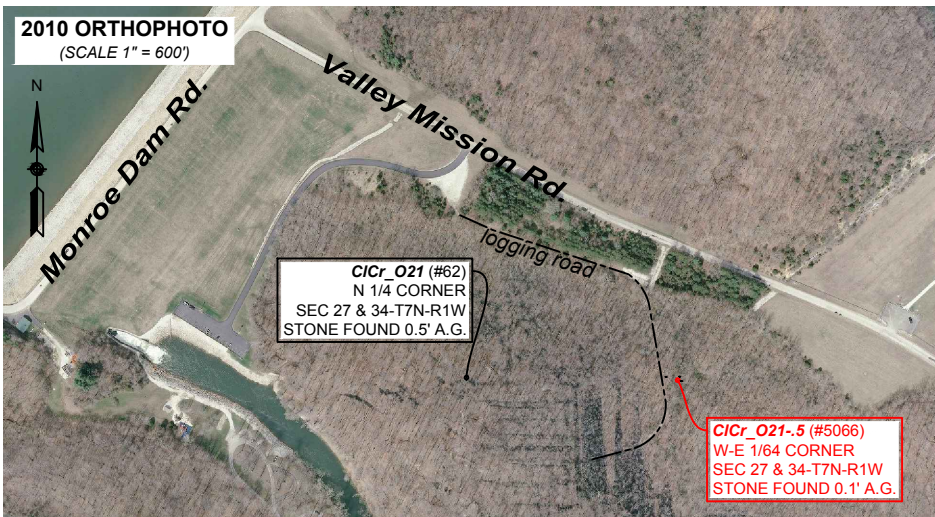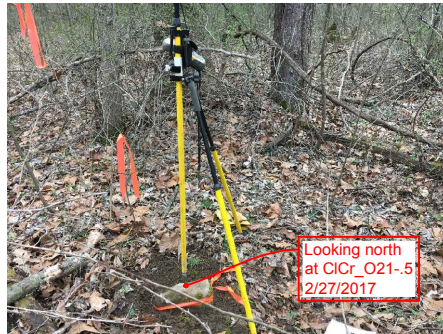

MONUMENT HISTORY:
ORIGINAL GOVERNMENT SURVEY:
Not an original government corner.

SUBSEQUENT CORNER RESTORATION:
 Date Surveyed: 10/11/1882 By: M. Buskirk
 MCSO Book 2, page 375
 Monument Set: *Not specified*
 Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Dist.(lks)	Dist. (ft)
Sweet Gum	4"	S45°W	5 lks	3.3'
Elm	2"	N25°E	4 lks	2.6'

Notes: Survey in Section 27-T7N-R1W

ORIGIN: This is not an original GLO corner. In October of 1882, M. Buskirk (Reference Survey ID 000029 - Monroe County Survey Book 2, pages 375-376) established this corner, but the monument type was not indicated. No evidence of his witness trees was recovered. This stone was accepted with no associated uncertainty.

HISTORY AND SEARCH PROCEDURE: No other survey records were found referencing a monument at this corner. However, Deed Book 106, page 431 references this corner as "a stone of earlier surveys." I walked about 660' east from the stone at CIGr_O21 and found some old north/south fence remains. The stone was covered in moss, but easily observable about 0.1' above grade. When the moss was removed, a distinct cut "+" was visible. It was faint, so I cut it a little deeper with my digging knife. No other markings were observed on the stone, but I only dug it up enough to tell that it was solidly planted.



Trohn Enright-Randolph
 Trohn Enright-Randolph
 Monroe County Surveyor



Accepted by the Monroe
 County Surveyor Review Board
 on March 20, 2018



Rachel Oser
 Rachel Savich Oser, State of Indiana
 Professional Surveyor No. 21100022

SHEET 2 OF 2	MONUMENT RECORD CORNER ID: CIGr_O21-.5	West-East 1/64 Corner Sections 27 & 34 - T07N-R01W Clear Creek Township Monroe County, Indiana		OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	--	--	--	---